



Model	Model Code	Year Model	Issue Date
CIVIC 5D	FK1, FK2, FK3	12	18-05-12
			Originator

Wind Noise From Door Mirror Area

Symptom


Wind noise emanating from the right or left door mirror between 40 and 50mph.

Cause


Two concerns can potentially lead to wind noise from the door mirror area.

Potential causes;

1. The Run channel sash foam has gaps, or is missing.

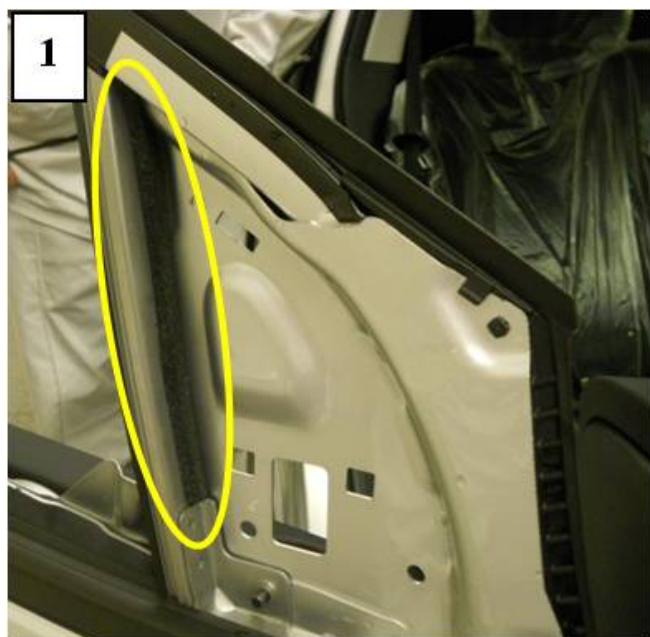

2. Run channel sash bracket gap has excessive clearance at the mirror fixing point.

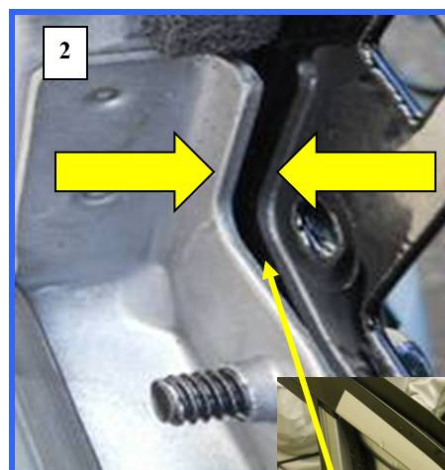

Application to Production Line


Application to Production Line will be confirmed at a later date.

Market Treatment


Repair on customer complaint only.

Repair Method

Run Channel sash foam gap or missing (A).

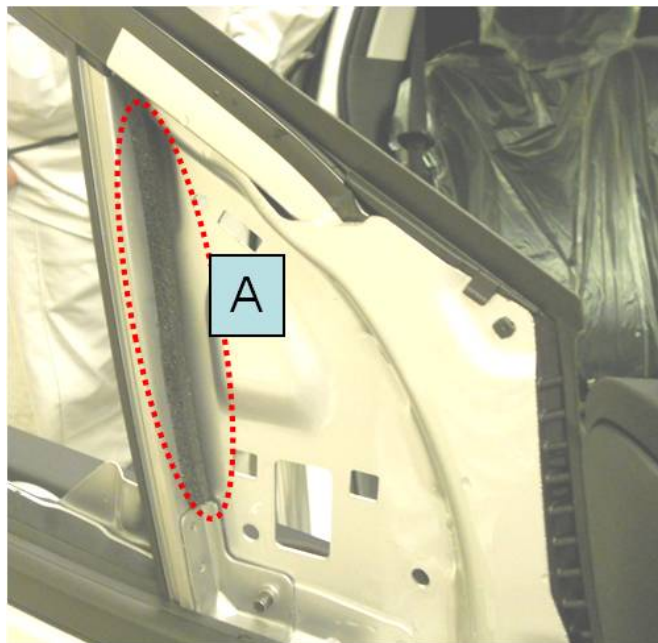


1. Remove the door mirror as described in MaRIS.
2. Remove all visible foam, be careful not to damage painted surfaces, or trim.
3. Degrease the Run Channel sash and bracket.
4. Apply a new piece of foam cut to the dimensions shown below to area A.
4. Ensure that the foam covers both the run channel sash and the mirror patch.

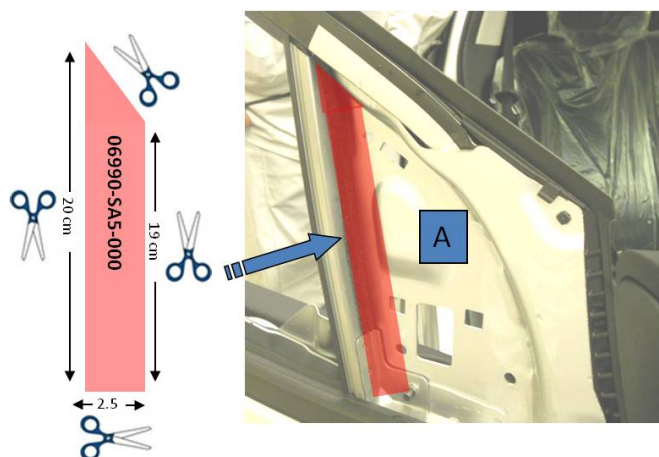


Use part number 06990-SA5-000 foam or equivalent foam with a maximum thickness of 4mm.

Run channel sash bracket gap (B)

Area of concern is at the Mirror base (C) shown below.

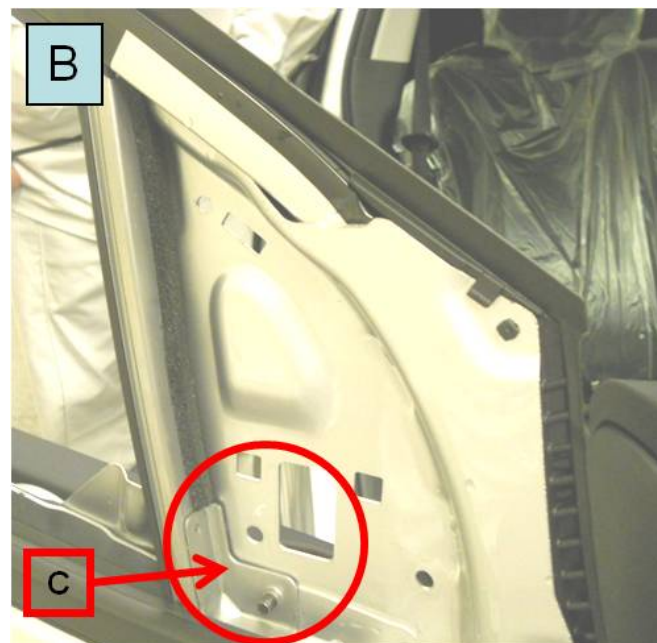

1. Remove the door mirror as described in MaRIS.
2. Degrease the Run Channel sash and bracket.
3. Apply a new piece of foam cut to the dimensions shown below to area B.
4. Make sure to cut a hole so that the door mirror stud passes through the patch.

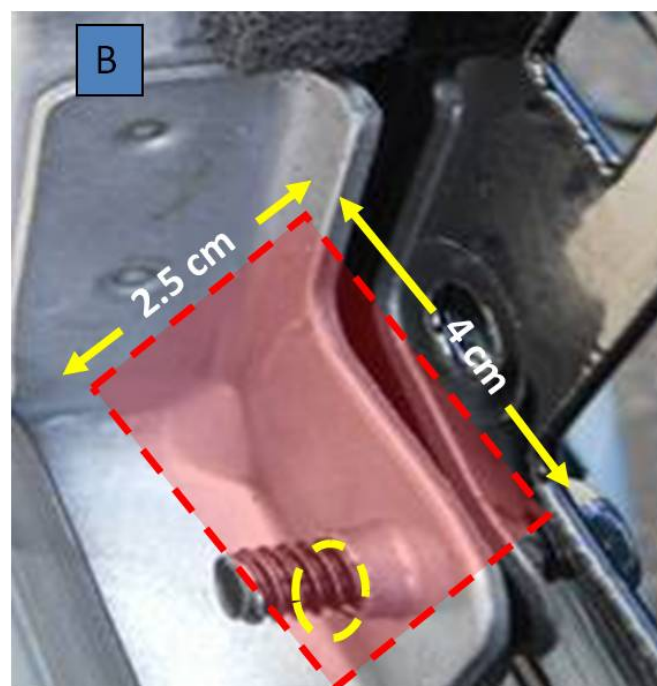



Below shows the completed repair to the Run channel sash and sash bracket with the foam applied to both points A and B.



Re-fit door mirror as described in MARIS. Test Drive the vehicle to ensure that the noise has been eliminated.

Parts Information

<Part Number> <Part Name>
1 X 2m Roll
06990-SA5-000 EPT FOAM SEALER T3

1 Roll will repair approximately 50 vehicles.
Claim for the EPT Foam Sealer should be claimed as an extra's cost.

Do not claim for the foam sealer by part number.

Warranty Information

Application: **Normal Warranty**

Causal Part: **72231-TV0-E01**

NEWS Symptom Code: **04201**

Operation No.(LON-NEWS Only):

LON	Description	FRT
820120	MIRROR, DOOR RIGHT - Replace	0.7
820100	MIRROR, DOOR LEFT - Replace	0.7

The EPT Foam seal should be claimed for as an Extra's Cost at a Rate of 12.50 Euro per repair (£10.00).

You should use the Sealant option from the drop down menu in NEWS claim.

Note: The allowable Extra's cost has been increased to cover the additional FRT for applying the foam.